


INSTRUCCIONES DE REMANUFACTURA DE CARTUCHOS DE TONER PARA LA IMPRESORA COLOR DELL 3000 CN




IMPRESORA COLOR DELL 3000 CN




CARTUCHO DE TONER DELL 3000 CN




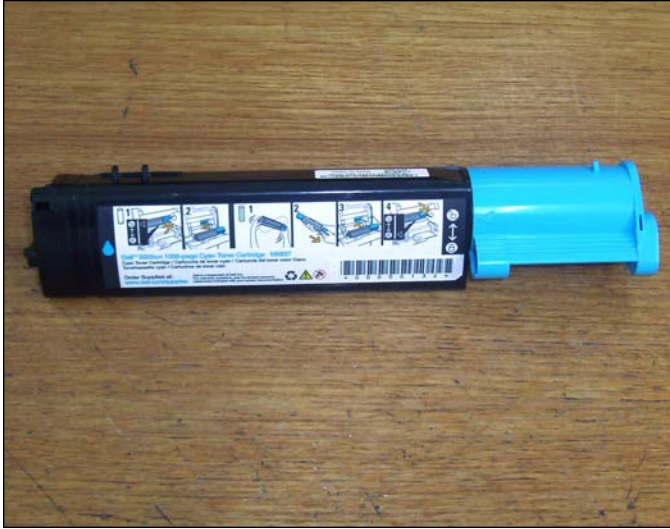

1. Desmontaje del cartucho de Toner, a partir de la posición de Bloqueado.

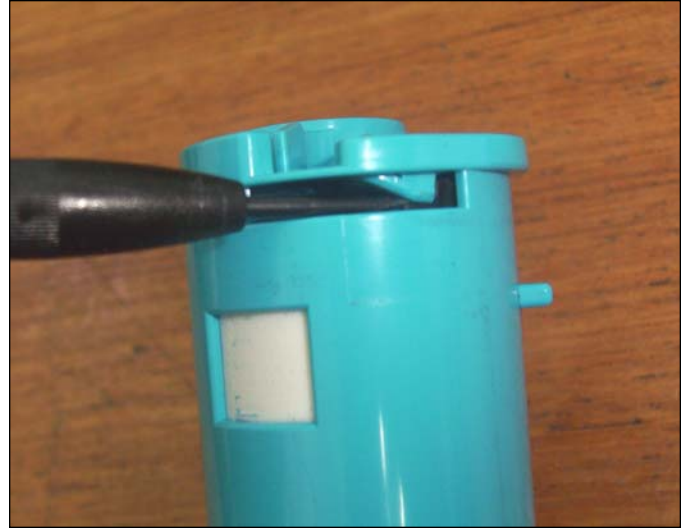

2. Por medio de un desarmador plano pequeño levantar la lengüeta de traba por arriba del taco de bloqueo. Esto permitirá girar la pieza del extremo en sentido anti horario. (La tapa en el extremo del cartucho tendrá colores diferentes dependiendo del modelo de cartucho).

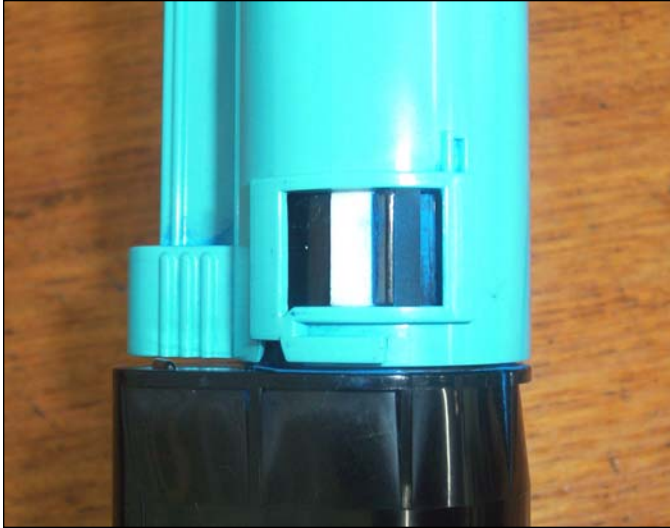

3. Este es el punto de partida.




4. Girar el collar hasta que la lengüeta llegue a parar definitivamente y haya entrado en la tapa azul.



| | | | | |
|--|---|---|---|--|
| USA Ph: +1 310-280-9620 Fx: +1 310-838-7294 | EUROPE +34-93-757-1335 +34-93-741-4166 | JAPAN +81-3-44-55-2789 +1 310-838-7294 | BRAZIL +55-11-4822-3033 +55-11-4822-3353 | ARGENTINA +54-11-4571-2388 +54-11-4574-3706 |
|--|---|---|---|--|

11124 Washington Blvd., Culver City, California U.S.A. 90232 • techsupport2@uninetimaging.com

All Trademark names are property of their respective owners. Product brand names mentioned are intended to show compatibility only. Uninet Imaging does not guarantee or warrant downloaded information.
© 2006 Uninet Imaging Inc.

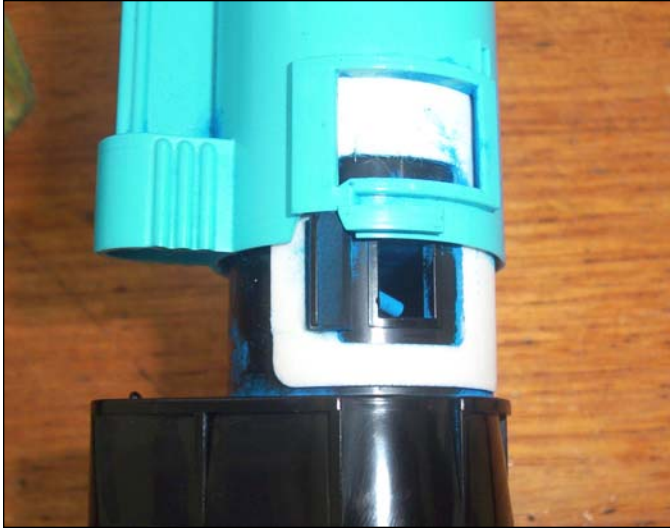

5. Empujar ahora la tapa hacia afuera del cartucho.



6. Retirar la tapa de carga del revelador.



7. Este es el deposito de desecho del Revelador que tendrá que ser vaciado. En el fondo encontrará el tapón de carga del toner. Retirar el mismo para limpieza y recarga.

NOTA: Mezclar el toner con Revelador en la misma botella de toner antes de rellenar el deposito de toner.

NOTAS:



www.uninetimaging.com



USA
Ph: +1 310-280-9620
Fx: +1 310-838-7294

EUROPE
+34-93-757-1335
+34-93-741-4166

JAPAN
+81-3-44-55-2789
+1 310-838-7294

BRAZIL
+55-11-4822-3033
+55-11-4822-3353

ARGENTINA
+54-11-4571-2388
+54-11-4574-3706

11124 Washington Blvd., Culver City, California U.S.A. 90232 • techsupport2@uninetimaging.com

All Trademark names are property of their respective owners. Product brand names mentioned are intended to show compatibility only. Uninet Imaging does not guarantee or warrant downloaded information.
© 2006 Uninet Imaging Inc.

SOLUCION DE DESPERFECTOS POST REMANUFACTURA

| | |
|---------------|--|
| Problema | La Impresora no reconoce el Cartucho |
| Detalles | La impresora lee la cantidad de Toner-Revelador en el depósito de desperdicios. Si el deposito se encuentra lleno de toner y revelador usado la lectura de la impresora podrá ser que el Cartucho se encuentra vacío e indicará el mensaje de "Toner Bajo." Luego de recargar, siga los siguientes pasos para continuar imprimiendo. |
| Recomendacion | <ol style="list-style-type: none"> 1. Apagar la impresora durante 3 a 5 minutos y encenderla nuevamente. 2. Una vez encendida, sacar el cartucho de la impresora, agitar e instalarlo nuevamente. 3. En la eventualidad que pasos 1 y 2 no resulten, retirar nuevamente el cartucho de la impresora y proceder a la nueva limpieza del citado deposito de desperdicios. |

NOTAS:



| | | | | |
|---------------------|-----------------|------------------|------------------|------------------|
| USA | EUROPE | JAPAN | BRAZIL | ARGENTINA |
| Ph: +1 310-280-9620 | +34-93-757-1335 | +81-3-44-55-2789 | +55-11-4822-3033 | +54-11-4571-2388 |
| Fx: +1 310-838-7294 | +34-93-741-4166 | +1 310-838-7294 | +55-11-4822-3353 | +54-11-4574-3706 |

11124 Washington Blvd., Culver City, California U.S.A. 90232 • techsupport2@uninetimaging.com

All Trademark names are property of their respective owners. Product brand names mentioned are intended to show compatibility only. Uninet Imaging does not guarantee or warrant downloaded information.
© 2006 Uninet Imaging Inc.